

YEAR 20
DATE 6/4/12

RECORDING TACH TIME 1030.6

TODAY'S FLIGHT

TOTAL TIME IN SERVICE 8775.0

Description of Inspections, Tests, Repairs and Alterations
 Entries must be endorsed with Name, Rating and Certificate Number of Technician or Repair Facility. (See back pages for other specific entries.)
 Installed New Landing Lamp P/N 6E4509 OPS Check
 good Del CMC App 3224728



Frederick Flight Center, Inc., 330 Aviation Way, Frederick MD 21701 800-355-0620.

Installed and updated GPS aviation data base software for a KLN 94 (type of GPS) on 6/28/2012 (Date). Operational check performed and no defects noted.
 Signed *[Signature]* Date 6/28/2012
 Print Name Katherine McClinton

Aircraft Log Entry
 Date: July 23, 2012
 Hobbs: 850.7
 Tach Time: 1050.10
 Registration #: N79NA
 Make/Model: PA44-180
 S/N: 44-7995307
 Total Time: *[Signature]*

- CMC / *[Signature]* Annual/100hr inspection
- Inspected EL IAW FAR 91.207(d) Next battery change due Oct 2013
- Installed new LH and RH vacuum regulator filters p/n B 3 5-1
- Installed shim at RH alternator rod and attach point
- Installed repaired Pilot and copilot inertial reel shoulder belts p/n 1107319-13 and repaired rear lap belts p/n 449968
- Belts repaired by BCS Aviation cert#D41R857Y ref work order N79NA
- Installed new Pilot and co pilot seat belt assembly p/n 504-872 (PSS50039 4-46)
- CMC AD 2005-15-10 by inspection of fuel heater pump IAW Kelly Aerospace IBA-110A. No defects noted at this time.
- Next inspection due @ 1150.10 tach.
- CMC AD 2004-25-16 R1 by inspection of the fuel regulator shutoff valve of heater IAW Kelly Aerospace SB A-107A. No defects noted at this time. Next inspection due @ 1150.10 tach.
- CMC Piper Service Letter 1087 Wing aft spar to fuselage attachment hardware inspection. Installed new aft wing to spar hardware. Next inspection due @ 1150.10 tach.
- CMC Piper SB 978A by inspection of wing spar hardware. No defects noted at this time. Next inspection due @ 1150.10 tach.

MAINTENANCE RELEASE
 The engine and/or component identified above was repaired and inspected in accordance with current Federal Aviation Regulations and was found airworthy for return to service with respect to the work performed.
 Signed *[Signature]* App 3224728 IA

YEAR 20
DATE



Aircraft Log Entry
 Date: July 26, 2012

Removed turn coordinator P/N 13941 K08-10219 Turn coordinator overhaul satisfactory

MAINTENANCE RELEASE
 The aircraft and/or component identified above and was found airworthy for return to service with respect to the work performed.
 Signed *[Signature]*



Aircraft Log Entry
 Date: August 2, 2012

Installed new flap control cable p/n 62701-10

MAINTENANCE RELEASE
 The aircraft and/or component identified above was repaired and was found airworthy for return to service with respect to the work performed.
 Signed *[Signature]*



Aircraft Log Entry
 Date: August 8, 2012
 Hobbs: 859.7

Installed repaired pilot and co pilot required by Belt Makers, Inc. cert#

MAINTENANCE RELEASE
 The aircraft and/or component identified above and was found airworthy for return to service with respect to the work performed.
 Signed *[Signature]*